

Welding Pipelines & Piping systems Procedures and Techniques

DSc Dževad Hadžihafizović (DEng)

Mechanical Engineer at Oil & Gas Professionals Sarajevo, Federation of Bosnia and Herzegovina, Bosnia and Herzegovina

Corresponding author

DSc Dževad Hadžihafizović (DEng), Mechanical Engineer at Oil & Gas Professionals Sarajevo, Federation of Bosnia and Herzegovina, Bosnia and Herzegovina.

Received: September 04, 2026; **Accepted:** September 10, 2026; **Published:** September 18, 2026

Introduction

This booklet is a guide to welding pipe with Shielded Metal Arc Welding (SMAW) and double ending pipe using automatic welding. Lincoln Electric supplies electrodes, power sources, automatic and semiautomatic wire feeders, submerged arc wire and flux, which are the industry standards for pipeline construction around the world.

Semiautomatic, self-shielded flux-cored Innershield® Process is being used around the world to produce high quality, low hydrogen, reliable, lower cost pipeline welds.

Vertical Down vs. Vertical Up Welding

Vertical down welding with cellulosic electrodes is normally done with high currents and high travel speeds. Cellulosic electrodes have a thin coating containing a large amount of organic cellulose. When the electrode is burned, the coating forms a protective gas coating for the molten metal. Because of the organic material and the moisture content of these electrodes, they have a very strong arc force but at the same time the weld metal freezes very quickly. This method of welding is fast and economical, consequently most cross country pipelines are welded with the progression vertically downward. Impact toughness properties, which are very good may be met with modern cellulosic electrodes.

Vertical up welding with either cellulosic electrodes or low hydrogen electrodes is done with relatively low currents and low travel speed, which produce joints with relatively few, but large beads.


With low hydrogen vertical up electrodes, welds may be made virtually free of slag entrapment and porosity. These welds are best able to meet strict radiographic requirements for high pressure, high temperature or low temperature piping. Because of the low hydrogen deposit, susceptible to

CROSS COUNTRY PIPELINE

Vertical Down Welding

Joint Preparation

The joint preparation usually used for cross country pipeline is from API 1104 code. As shown in the figure below, the normal situation is a "penny land, penny gap", meaning that the land (root face) on the pipe should be ground to approximately the thickness of a penny [$1/16$ " (1.6mm)]. The gap between pipes should be the same distance, if possible. A 60° Included angle is used.

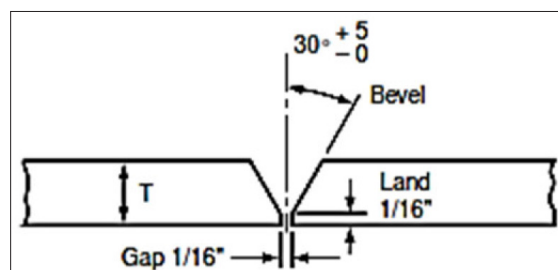

Pipe End Cleaning

Pipe rarely will be received in a condition suitable for welding. Generally, there will either be an oil or rust coating, or a coating to prevent corrosion. This could include paint, primer, varnish, epoxy, tar paper, or any variety of organic substances, all of which are undesirable for welding. Cleanliness is critical to prevent defects leading to rejected welds and costly repair, so these coatings must always be removed.

- Moisture and condensation must always be removed prior to welding.
- Both pipe ends must be cleaned, on the inside and the outside, at least 1" (25mm) beyond the edge of the bevel.
- One recommended means of cleaning pipe is with a straight shaft grinder with a rubber expanding wheel and carbide coated sleeve. A sanding disc can also be effective, as well

as an abrasive grinding disc.

- Depending on the pipe size, a half round file can be used to remove any burrs created when the land is ground on to the end of the pipe.

Welding the Root Pass

Before beginning to weld the pipe, the procedure should be checked to assure that the correct electrode is being used. This includes the diameter and the classification of the electrode. The welding consumable should be selected to correctly match (or overmatch) the strength of the pipe.

Either Fleetweld® 5P or Fleetweld 5P+ should be used for stringer bead and the hot pass when the hardness of the root pass is a concern, even if other higher strength consumables are to be used to fill and cap the weld. This "softer" root increases the resistance to certain types of weld cracking.

A number of factors will determine how many welders will be needed to weld the root pass. In any case, it is best to have welders either (1) weld opposite one another or (2) evenly spaced around the pipe. This will minimize the amount of distortion in the pipe and prevent the gap from opening or closing. If possible, it is also desirable not to finish a weld in exactly the bottom of the pipe because the tie-in can be more difficult. Similarly, it is best to avoid starting at exactly the top of the pipe (12 o'clock position).

As a rule of thumb, for a 5/32" (4.0mm) electrode, on the welding time for one electrode should be approximately one minute and the length of weld should be approximately the same as the length of electrode consumed. This would produce a travel speed of approximately 12 inches per minute, but this is extremely sensitive to joint preparation and exact welding conditions.

The root pass is welded with a "drag" technique. The tip of the electrode is held in contact with both pipes and dragged around the circumference of the pipe, progressing vertically downward. The electrode initially should be held roughly perpendicular to the pipe. If there is a proper fit-up and the proper current is used, a small "keyhole" will be seen following behind the electrode. If the keyhole is not seen, the electrode is not penetrating through to the inside of the pipe. The remedies for this would be:

- Higher current.
- Apply more pressure on the electrode which lowers voltage and yields a colder puddle (depending on the type of welding machine).
- Use a push angle (although this is not always advisable).
- Slower travel speed.

If the keyhole becomes too large and difficult to control, the remedies would be:

- Lower the current.
- Travel faster until the size of the keyhole decreases.
- Use more of a drag angle while using faster travel speed until the keyhole becomes more manageable.
- Apply less pressure on the electrode which creates a bigger key-hole.

The required current decreases as the gap size increases. If the gap is too narrow, it is not unusual to push so hard on the

electrode that a 5/32" (4.0mm) electrode will bend.

Sometimes, because of magnetic conditions the arc will tend to push to one side of the joint. This is called arc blow. There are two solutions to this while welding:

- Put side pressure on the electrode opposing the arc blowing tendency. This will cause the coating to burn more even, and equalize the burnoff and tie-in equally.
- While continuing to weld, point the electrode to counter-act the arc blow. This is the less desirable method because it can lead to internal undercut defects.

Current Setting with Lincoln Engine Driven Welders

The following recommendations are based on the following assumptions:

- Welding is done in the vertical down (5G or 6G) position.
- A cellulosic electrode (E-XX10) is being used.
- The root pass is welded with reverse (DC+) polarity.
- The hot pass is made with a 5/32" (4.0mm) diameter electrode.
- The fill pass is made with a larger diameter 3/16" (prime 5.0mm) electrode.
- The joint has been carefully prepared to API specifications (1/16" land, 1/16" gap and 60 deg included angle).

The joint fit-up will rarely be perfect, so the following recommendations should be used ONLY as a starting point. The welder's skill and the characteristics of their machine and the joint conditions will all contribute to variations from the recommended set points. The settings given on page 8 are intended only as starting points.

For root pass welding, the current control should be set as high as necessary while the open circuit voltage (OCV) is set as low as possible, while still permitting the arc to strike without sticking. In practice, it is not obvious by looking at the dials on the machine how to accomplish this.

Root Pass Welding

Welder	Range Control Setting	Fine Control Setting
Pipelinor® 200G Classic II Classic 300G Classic 300D SA-250	Current Range Selector	Fine Current Adjustment
	240-160 (or) 190-120	~30 40
	Variable Voltage Control	Current Control
	5	100 - 150
SAE-400	Job Selector	Current Control
	Lower end of Overhead & Vertical Section	~150
Commander™ 300 Commander 500	Process & Range Selector	Output Control
	250 Max.	6 - 7

In each case listed above, with the proper fit-up, the current with a 5/32" (4mm) diameter electrode will be in the neighborhood

of 130 amps. From this point, the current should be changed according to the individual welder's skill and needs. In the United States, root pass welding is usually done with r locations straight polarity (DC-) is faster then positive therefore travel speed should be faster and inter-nal undercut and hollow bead defects are less likely. DC- (straight) polarity is also advisable for thin wall pipe to prevent burn through.

Techniques for Welding Hot Passes

After the root pass is welded, the root bead is generally very convex on the exterior of the pipe. The normal procedure is to grind the root pass to eliminate the excessive convexity. Normally, the entire weld is not ground out, rather only enough to expose "wagon tracks". These are lines of slag that are on either side of the built up convex region.

The purpose of the hot pass is primarily to burn out the "wagon tracks". Ideally, this is achieved leaving the joint free of undercut and some filling of the joint is also accomplished. To do this, a high current is normally used. With 5/32" (4.0mm) cellulosic electrodes, a current of 160-200 amps is normally used, but using higher current values, the electrode can overheat. Larger (3/16" diameter) elec-trodes can also be used, with currents around 180 amps. Larger electrodes have a tendency to fill rather than dig.

Techniques for Welding Fill and Cap Passes

The exact procedure for welding fill and cap passes is dependent on the characteristics of the pipe (wall thickness, temperature, and posi-tion on the pipe), the skill of the welder, as well as the characteristics of the welding machine. With SMAW stick electrodes, the idea is nor-mally to fill the joint as quickly as possible. When welding vertically down, higher currents may be used than vertical up welding, so the melting rate of the electrode is greater and the joint can be filled in less time. Additionally, the usual practice is to use a larger diameter electrode for the fill passes than what had been used for the root and hot passes [3/16" (5.0mm) electrode when 5/32" (4.0mm) electrodes were used for the root and hot passes].

In critical applications for low temperature service, it may be neces-sary to maximize the impact toughness properties of a weld. In this case, one technique is to split the layers into 2 passes as soon as possible. The objective is to align fine-grained reheated zones along the centerline of the weld, where the test samples are taken. Fill passes should continue until the joint is filled to flush or slightly below flush with the pipe. If the beveled edges of the joint are visible, the cap pass(es) can be welded more easily.

The cap pass should be welded at lower currents than the fill passes [as low as 140 amps with a 3/16" (5.0mm) electrode].

Setting the Current for Hot Pass, Fill Pass, "Stripper Pass" and Cap Pass Welding

The purpose for the hot pass is to melt and float out the wagon tracks left after the root pass. The current, therefore, should be high enough to burn out the slag, but not so high as to burn a hole through the root pass.

The root pass should be thoroughly cleaned before welding the hot pass. This is typically done with a disc grinder, which not

only cleans out the slag, but also flattens the contour of the bead before the hot pass is welded. If this grinding operation is not done, there is a greater chance that wagon track slag entrapment will occur.

The hot pass should be started as soon as possible after completely finishing the root pass, always within five minutes.

The hot pass should be started as soon as possible after completely finishing the root pass, always within five minutes.

The typical current for a hot pass ranges from 160 to 200 amps with either 5/32" (4.0mm) or 3/16" (5.0mm) electrodes. The welding travel speed increases with increasing current, as does the ability to clean out wagon tracks. The risk of burning through, especially on the top and the bottom of the pipe also increases and the usable length of electrode decreases. With high current, the electrode may overheat and catch fire. At this point, even if a long stub remains, welding should stop and the electrode should be thrown away.

With low current, there is little risk of burning through, but welding progresses slower and more care must be taken to assure that the wagon tracks are eliminated.

For the passes after the root pass, the tap setting is generally not adjusted. The current should be adjusted by adjusting the fine con-trol. Typically this is done with a remote control.

With the SAE-400, the left tap (Job Selector) should be increased to run the hot pass. Using the Commander 300, the hot pass might be run with the 230 max tap and the control increased to 7 or 8.

Fill passes are usually run with 3/16" (4.8mm) or 5.0mm electrodes. Depending on the wall thickness, interpass temperature, etc., the current could be between 160 and 200 amps, which may not requires changing the machine setting from the hot pass.

A slight side-to-side weave should be used when welding a fill pass. This allows the bead to wet-in properly with the side walls and helps fill the groove.

The current used on stripper passes depends on which diameter of electrode is to be used. The purpose of a stripper pass is to fill the joint up to flush. Instead of high travel speeds, lower currents may be used.

Before welding the cap pass, the concave portions of the weld should be welded up to flush with stripper passes, commonly required only in the 2 to 5 o'clock positions. Either 5/32" (4.0 mm) or 3/16" (5.0 mm) diameter electrodes can be used.

Cap passes are frequently run with lower currents than the fill passes. With 150 amps and a 3/16" (5.0mm) diameter electrode, it is possi-ble to put in a uniform bead all the way around the pipe.

Preventing Cracking

Good welding practice is essential in preventing weld cracking, which includes preheating when needed. The welding techniques

described in this book will minimize the defects which could cause cracking. Depositing the hot pass in a timely manner is helpful, as well as depositing as large a root pass as possible.

The need for preheating varies considerably depending on the grade of pipe steel. The tendency to crack increases with increasing pipe strength, wall thickness, carbon and alloy content, as well as decreasing ambient temperature. Welding low strength pipe in warm weather, the need to preheat may not be required, (although recommended for moisture removal). Thick wall, high strength pipe being welded in cold weather may require up to 350°F (177°C) preheat. Specific preheat requirements must be determined for each situation.

Techniques for Welding High Strength Pipe (X-60, X-65, X-70 and X-80 Pipe)



These recommendations are suggested to help produce crack-free welds with a minimum of defects on high strength pipe.

- Joint preparation and line-up must be carefully controlled. High-low conditions should be held to a minimum.
- Thin walled [up to 3/8" (10mm)] X-80 pipe can be welded with Shield-Arc 90. Weld X-70 pipe with either Shield-Arc 80 or Shield-Arc 70+. Pipes X-60 and X-65 pipes can be welded with Fleetweld 5P+, Shield-Arc HYP, Shield-Arc HYP+, Shield-Arc 70+ or Shield-Arc 80.
- Preheat cold pipe to at least 70°F (21°C). The exact degree of pre-heat depends on the pipe steel, but preheating up to 350°F (177°C) would not be unreasonable for X-80 pipe.
- An internal fit-up clamp should not be removed until the entire root pass is complete.
- Fewer defects will be seen if restarts and stops (craters) are ground out, with the stops ground down to a feathered edge.
- Don't start the root pass welds at exactly the top of the pipe (12 o'clock position) or end them at exactly the bottom (6 o'clock position). Stopping the weld at the 6 o'clock position can contribute to burnthrough, tie-in or suck-back problems.
- When finishing an electrode on the root pass, a fast pullout (flicking the electrode) can reduce the size of the remaining keyhole, making tie-in easier.
- Since reverse polarity (DC+) is commonly used by U.S. pipeline operators for root pass welding, switch to straight polarity (DC-) when burn through, internal undercut and hollow bead defects persist. Polarity change is an essential variable in API 1104 code -requiring a procedure qualification.
- Excessive travel speed in either the root or hot pass will cause defects.
- Start and complete the hot pass immediately after completion of the root pass.
- If the temperature of the pipe has dropped below the prescribed interpass temperature, reheat the entire joint.

Vertical Down Procedures (E6010, E7010, E8010 or E9010)

DC+

Currents up to 200 amps are often used on the hot and fill passes but cause premature coating breakdown and large stub losses.

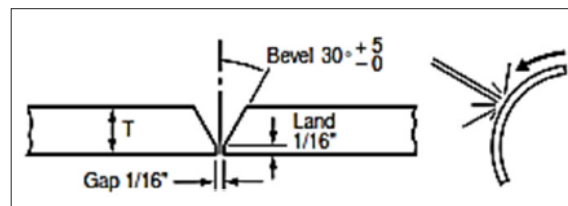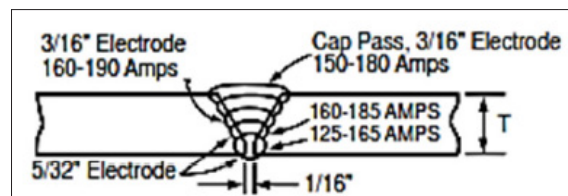

Use 1/8" (3.2 mm) diameter electrode for the stringer bead when the gap is too small to permit use of the 5/32" (4.0 mm) size or where the silicon level causes a larger than normal keyhole.


Stripper passes may be required in the 2 to 5 o'clock position.

Pipe Wall Thickness		No. of Passes
Inches	(mm)	
5/16	(7.9)	4
3/8	(9.5)	5
1/2	(12.7)	7

The number of passes may vary depending on the operator, electrode diameter and procedure.

Alternate Vertical Down Stringer Bead Procedure (E6010, E7010, E8010 or E9010)

DC-

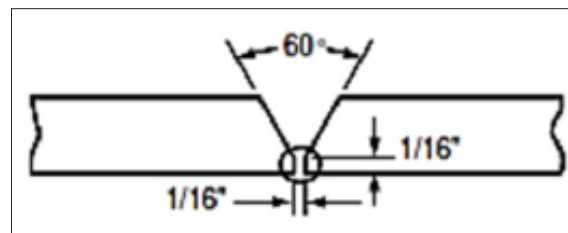


- (1) Root pass welding with 3/16" (4.8mm) diameter electrode requires more operator skill. Pipe land and gap tolerances are more critical when using 3/16" (4.8mm) electrode for stringer bead applications. Lower consumable cost is the primary advantage for 3/16" (4.8mm) diameter. Its use will not provide any significant increase in arc speed over 5/32" (4.0mm) diameter.

- (1) Includes four inch stub lengths. These figures will vary with different stub loss practices.


Quantities required for the 5/32" diameter will vary based on travel speeds of the root pass and hot pass. Slow travel speeds may increase these quantities by up to 50%.

Cross Country Pipe - Vertical Down Electrode Consumption

Wall Thickness							Wall Thickness								
5/16"			3/8"			1/2"			5/8"			3/4"			
Electrode Required per Joint (lbs.) ⁽¹⁾							Electrode Required per Joint (lbs.) ⁽¹⁾								
Pipe Diameter	5/32"	3/16"	Total	5/32"	3/16"	Total	5/32"	3/16"	Total	5/32"	3/16"	Total	5/32"	3/16"	Total
6 Inch	.34	.54	.88	.34	.86	1.2									
8 Inch	.45	.71	1.2	.45	1.1	1.6	.45	2.2	2.7	—	—	—	—	—	—
10 Inch	.56	.88	1.4	.56	1.4	2.0	.56	2.7	3.3	—	—	—	—	—	—
12 Inch	.67	1.0	1.7	.67	1.7	2.4	.67	3.2	3.9	—	—	—	—	—	—
14 Inch	.73	1.1	1.8	.73	1.8	2.5	.73	3.5	4.2	.73	5.7	6.4	.73	8.3	9.0
16 Inch	.84	1.3	2.1	.84	2.1	2.9	.84	4.0	4.8	.84	6.5	7.3	.84	9.4	10.2
18 Inch	.94	1.5	2.4	.94	2.3	3.2	.94	4.5	5.4	.94	7.3	8.2	.94	10.6	11.5
20 Inch	1.1	1.6	2.6	1.1	2.6	3.7	1.1	5.0	6.1	1.1	8.1	9.2	1.1	11.8	12.9
22 Inch	1.2	1.8	3.0	1.2	2.9	4.1	1.2	5.5	6.7	1.2	8.9	10.1	1.2	13.0	14.2
24 Inch	1.3	2.0	3.3	1.3	3.1	4.4	1.3	6.0	7.3	1.3	9.7	11.0	1.3	14.2	15.5
26 Inch	1.4	2.1	3.5	1.4	3.4	4.8	1.4	6.5	7.9	1.4	10.5	11.9	1.4	15.3	16.7
28 Inch	1.5	2.3	3.8	1.5	3.7	5.2	1.5	7.0	8.5	1.5	11.3	12.8	1.5	16.5	18.0
30 Inch	1.6	2.5	4.1	1.6	3.9	5.5	1.6	7.5	9.1	1.6	12.1	13.6	1.6	17.7	19.3
32 Inch	1.7	2.6	4.3	1.7	4.2	5.9	1.7	8.0	9.7	1.7	13.0	14.7	1.7	18.9	20.6
34 Inch	1.8	2.8	4.6	1.8	4.4	6.2	1.8	8.6	10.3	1.8	13.8	15.6	1.8	20.1	21.9
36 Inch	1.9	2.9	4.8	1.9	4.7	6.6	1.9	9.1	11.0	1.9	14.6	16.5	1.9	21.3	23.2
38 Inch	2.0	3.1	5.1	2.0	5.0	7.0	2.0	9.6	11.6	2.0	15.4	17.4	2.0	22.4	24.4
40 Inch	2.1	3.3	5.4	2.1	5.2	7.3	2.1	10.1	12.2	2.1	16.2	18.3	2.1	23.6	25.7
42 Inch	—	—	—	2.2	5.5	7.7	2.2	10.6	12.8	2.2	17.0	19.2	2.2	24.8	27.0
44 Inch	—	—	—	2.3	5.7	8.0	2.3	11.1	13.4	2.3	17.8	20.1	2.3	26.0	28.3
46 Inch	—	—	—	2.4	6.0	8.4	2.4	11.6	14.0	2.4	18.6	21.0	2.4	27.2	29.6
48 Inch	—	—	—	2.5	6.3	8.8	2.5	12.1	14.6	2.5	19.4	21.9	2.5	28.3	30.8

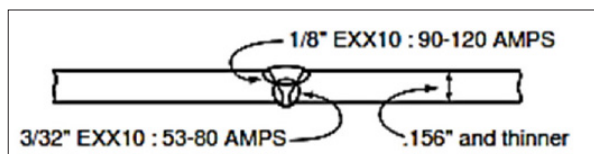**Polarity DC+**

In some cases 5/32" (4.0 mm) diameter electrode may be used for the recommended. For root pass welding, see Alternate Vertical Down Procedure on page 16.

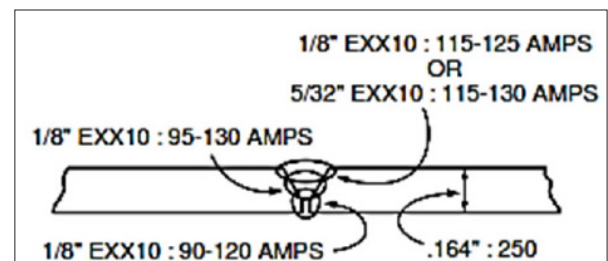**Polarity DC+**

Fleetweld 5P+ is recommended. However, Fleetweld 5P, Shield-Arc 85 or Shield-Arc HYP+ can be used, providing the same diameter electrode is used.

Vertical Down Electrode Consumption


Wall Thickness					Wall Thickness				
	.125"			.188"			.250"		
Electrode Required per Joint (lbs.) ⁽¹⁾					Electrode Required per Joint (lbs.) ⁽¹⁾				
Pipe Diameter	3/32"	1/8"	Total	1/8"	5/32"	Total	1/8"	5/32"	Total
4 Inch	.071	.092	.163	.196	.146	.342	.232	.177	.409
4-1/2 Inch	.080	.102	.182	.221	.164	.385	.261	.199	.460
6 Inch	.106	.138	.244	.294	.219	.513	.348	.268	.616
6-5/8 Inch	.118	.152	.270	.325	.242	.567	.384	.293	.677
8 Inch	.142	.184	.326	.392	.292	.684	.464	.354	.818
8-5/8 Inch	.153	.198	.351	.422	.314	.736	.500	.382	.882
10 Inch	.178	.230	.408	.490	.365	.855	.581	.442	1.023
10-3/4 Inch	.191	.247	.438	.526	.392	.915	.623	.475	1.098
12-3/4 Inch	.223	.289	.512	.615	.458	1.073	.727	.552	1.279

14 Inch	.248	.323	.571	.686	.520	1.206	.812	.615	1.427
16 Inch	.284	.369	.653	.784	.593	1.377	.929	.703	1.632
20 Inch	.355	.461	.816	.980	.741	1.721	1.161	.879	2.040
24 Inch	—	—	—	1.177	.890	2.067	1.393	1.062	2.455
28 Inch	—	—	—	1.372	1.040	2.412	1.624	1.230	2.854
32 Inch	—	—	—	1.568	1.186	2.754	1.858	1.406	3.264
36 Inch	—	—	—	1.764	1.338	3.102	2.089	1.582	3.671

⁽¹⁾Includes four inch stub lengths. These figures will vary with different stub loss practices. Quantities required for the smaller diameter electrode may vary by up to 50%, based on size and travel speed of the root pass. Heavier cap passes will increase total electrode requirements by up to 50%.

Vertical Down - Bell & Spigot

Use a straight progression or short whipping technique. The latter is better for poor fit up and also for controlling the puddle in the 5 to 7 o'clock position. Use one pass. If portions of the weld are shallow, apply a second pass.

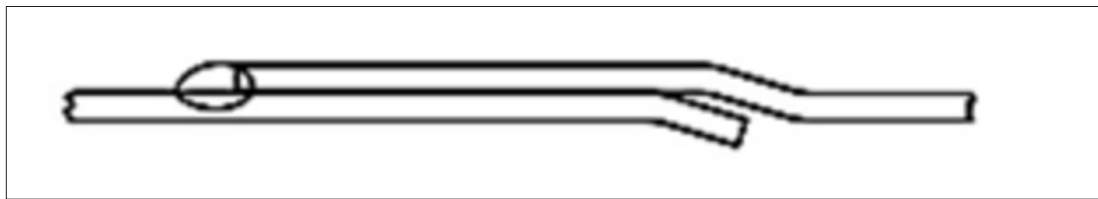

Electrode Consumption

Wall Thickness			Electrode Required Per Joint			
			Pipe Diameter			
Gauge	Decimal	Fraction	4"	4-1/2"	6"	6-3/8"
14	.075"	5/64"	.041	.046	.062	.068
13	.090"	3/32"	.053	.059	.078	.088
12	.105"	7/64"	.078	.088	.114	.129
—	.125"	1/8"	.095	.107	.142	.157
10	.135"	9/64"	.100	.113	.150	.166

Double Ending

Double ending is the automatic submerged arc welding of two lengths of pipe into one longer length. It is practical where terrain permits hauling the automatic welding stations and the double lengths of pipe.

The automatic welding methods weld joints faster than is possible with stick electrodes. This reduces welding costs, but, more importantly, it increases the miles of pipe that can be laid each day.

Double ending also increases pipe laying speed because the submerged arc process consistently makes high strength welds of excellent X-ray quality. Few "cutouts" are required.

Along the Right of Way

Double ending along the right of way utilizes portable automatic welding stations which are moved frequently as the line progresses. It eliminates the need for hauling double lengths of pipe long distances.

Weld the root pass with stick electrode or semi-automatic processes and the usual internal line-up clamps. To avoid cracking, the stringer bead should have a minimum of 3/16" (4.8 mm) throat and, ideally, the first automatic bead should be

started immediately after completion of the stringer bead. The other beads are welded by rotating the pipe beneath an automatic welding head.

Stationary Double Ending

The stationary double ending automatic welders work at pipe delivery points. The double length pipe section are hauled to the pipeline for laying. When appropriate, the automatic welders are moved to the next pipe delivery station.

Both two and three station equipment is used. With three station equipment, only the first pass is welded at the first station. The other external beads are welded at the second station. With two station equipment, all external beads are welded at the first station. The internal bead is always welded at the final station.

NOTE: The Lincoln Electric Company strongly recommends for weldments intended for sour gas, sour crude, or other critical service applications that the customer verifies that both the level of hardness and variation in hardness of the weld, heat affected zone, and base plate are within acceptable limits.

Flux and Electrode Selection

Because of the high dilution characteristic of this type of welding, the mechanical properties of the weld are highly dependent on

the chemistry of the pipe. All welding materials and procedures should be tested on actual pipe steel under field conditions to determine usability.

Flux

860 neutral flux is the most recommended flux, depending on job requirements and welding conditions. 882 neutral flux may be used on some lower carbon pipe heavier wall thicknesses.

Electrodes

L-60-Most popular choice with 860 flux. Lowest hardness. Preferred for pipe intended to carry sour gas or sour crude.

L-61-Intermediate hardness. Improved bead appearance over L-60.

L-50-Highest hardness of mild steel electrodes. Improved bead appearance over L-61. Improved impact strength vs. L-60 at -20°F (-29°C) on pipe 3/4" (19 mm) wall thickness or greater.

LA-75-Similar in hardness to L-50. Best bead appearance. Highest impact strength at -50°F (-45°C) on wall thicknesses of approximately 3/4" (19mm) or greater. Deposits contain approximately 1% nickel.

860/L-60 will meet the minimum yield requirements and produce low hardness and good impact strength at -20°F (-29°C) on X-42 through X-60 pipe. 860/L-60 will also meet the minimum yield requirements and produce low hardness and good impact strength on most X-65 and some X-70 pipe, depending on plate chemistry, wall thickness, and procedures.

If strength is too low with L-60, it may be necessary to use L-61 or L-50. On some pipe steels, L-61 or L-50 with 860 flux may be required to meet minimum Charpy impact requirements. The

weld matrix hard-ness and tensile strength will be higher with L-61 or L-50 than with L-60. With single arc double ending procedures, L-70 will not produce higher impact strength than L-60 and will results in higher weld matrix hardness.

Because of the large variations possible in pipe chemistry, all consum-ables should be tested on actual pipe steel to verify that requirements will be met.

API Pipe Steel

The following data is partial review of the 38th edition (May 1990) of API specification 5L. For the latest specific details, obtain a copy of API Standard 5L.

Definitions

The most common steel used for oil and gas cross country pipeline is the API 5LX series. Meanings of these pipe designation are as follows:

5L Specification for line pipe.

X Grade designation for high strength line pipe.

The two numbers following the "X" are the first two digits of the mini-mum yield strength. For example X-60 has a minimum yield strength of 60,000 psi (414 MPa).

Carbon and Manganese Content

When the pipe carbon and manganese content is near the maximum allowed by the pecifications, welding without cracking is difficult, par-ticularly in cold weather. Therefore, pipe is commonly made using steel of lower carbon and manganese content. High mechanical properties are tained by cold expanding the pipe.

When pipe analysis is near maximum, follow the techniques under "Preventing Cracking" on page 10.

Chemical Requirements for Heat Analysis

Process of Manufacture: Electric furnace, open-hearth, basic-oxygen or killed deoxidized basic- bessemer

Welded	Grade	Carbon Max. (%)	Manganese Max. (%)	Phosphorus Max. (%)	Sulfur Max. (%)
Non-expanded	X-42	0.28	1.25	0.04	0.05
Non-expanded	X-46, X-52	0.30	1.35	0.04	0.05
Cold-expanded	X-42, X-46, X-52	0.28	1.25	0.04	0.05
Non-expanded	X-56 ⁽¹⁾ , X-60 ⁽¹⁾	0.26	1.35	0.04	0.05
(or)	X-65 ⁽¹⁾	0.26	1.40	0.04	0.05
Cold-expanded	X-70 ⁽¹⁾	0.23	1.60	0.04	0.05
	X-80	0.18	1.80	0.03	0.018

⁽¹⁾ May also contain small amounts of columbium, vanadium or titanium.

High Silicon Pipe

Surface pinhole porosity may sometimes be encountered when weld-ing 5LX pipe containing high silicon (up to 0.35%). Use currents in the lower end of the current range or smaller diameter electrodes to minimize this problem.

X-56, X-60, X-65, X-70 & X-80 Pipe

Since these pipe steels may have an analysis other than specified see footnote (1), above, and there is no upper limit on strength, pipe with a tensile strength of 100,000 psi (689 MPa), sometimes arrives on the job. Making crack-free welds in this steel requires careful attention to the "Techniques for Welding High Strength Pipe" discussed on page 10.

Preheat and interpass temperature control are recommended for optimum mechanical properties, crack resistance and hardness

control. This is particularly important on multiple pass welds and heavier plate. Job conditions, prevailing codes, high restraint, alloy level and other considerations may also require preheat and interpass temperature control.

NOTE: The Lincoln Electric Company strongly recommends for weldments intended for sour gas, sour crude, or other critical service applications that the customer verifies that both the level of hardness and variation in hardness of the weld, heat affected zone, and base plate are within acceptable limits.

Pipe Grades - Minimum Yield and tensile Strengths

Pipe Grade	Minimum Yield		Minimum Tensile	
	psi	MPa	psi	MPa
X-42	42,000	290	60,000	414
X-46	46,000	317	63,000	434
X-52	52,000	358	66,000	455
X-56	56,000	386	71,000	489
X-60	60,000	414	75,000	517
X-65	65,000	448	77,000	531
X-70	70,000	483	82,000	565
X-80	80,000	552	90,000 ⁽²⁾	620

⁽²⁾ 120,000 maximum.

Consumables for Pipe Welding

Currently, there are four categories of consumables available for welding pipes of various strength levels.

- SMAW (Shielded Metal Arc Welding)**

Cellulosic Electrodes

Vertical Up, Low Hydrogen Electrodes

Vertical Down, Low Hydrogen Electrodes

- FCAW (Flux-Cored Arc Welding)**

Self-Shielded (Innershield Electrodes

Gas-Shielded (Outershield) Electrodes

- GMAW (Gas Metal Arc Welding)**

Solid Wire Electrodes

Root Pass Welding with STT Power Supply

- SAW (Submerged Arc Welding)**

Solid Wire Electrodes with Flux for Double Ending(1)

For any grade of pipe, there are possibilities for both process and the consumable to be used. The table below gives various electrode choices for different strength pipes. These are for fill and cap passes. Lower strength electrodes commonly are used for root and hot passes.

Electrode	X-52 & Under	X-56	X-60	X-65	X-70	X-80
Fleetweld 5P	✓	✓				
Fleetweld 5P+	✓	✓	✓	✓		
Shield-Arc HYP	✓	✓	✓	✓		
Shield-Arc HYP+	✓	✓	✓	✓		
Shield-Arc 85	✓	✓	✓	✓		
Shield-Arc 70+		✓	✓	✓	✓	
Shield-Arc 80		✓	✓	✓	✓	
Shield-Arc 90				✓	✓	✓

Lincoln 16P	✓	✓	✓	✓		
Lincoln 18P		✓	✓	✓	✓	✓
Lincoln LH D-80		✓	✓	✓	✓	
Lincoln LH D-90		✓	✓	✓	✓	✓
Lincoln LH D-100		✓	✓	✓	✓	✓
NR-207, 207-H	✓	✓	✓	✓	✓	
NR-208-H		✓	✓	✓	✓	✓
SuperArc L-50	✓	✓	✓	✓		
SuperArc L-56	✓	✓	✓	✓		
SuperArc LA-75			✓	✓	✓	
SuperArc LA-90			✓	✓	✓	✓
SuperArc LA-100			✓	✓	✓	✓

Consumables for High Strength Pipe

The mechanical requirements of x-80 pipe are a yield strength of at least 80,000 psi (551 MPa), minimum ultimate tensile strength of 90,000 psi (620 MPa), and a maximum ultimate tensile strength of 120,000 psi (827 MPa).

The mechanical property requirements of the weld are not as clearly defined. API 1104 requires that when tested, with a transverse tensile test, either:

- The weld metal exceeds the specified minimum tensile strength of the pipe (with the root pass and cap pass reinforcement in tact),
or
- The pipe material breaks first. Because the reinforcement is left intact, the weld metal does not necessarily need to be as strong as the pipe.

A level of ductility in the weld metal is required to pass a guided bend test, but there are no explicit requirements for the tensile test.

Strength Requirements for Pipe Grades

Pipe Grade	Minimum Yield Strength		Minimum Tensile Strength		Maximum Ultimate Tensile Strength	
	psi	MPa	psi	MPa	psi	MPa
X-42	42,000	289	60,000	413	—	—
X-46	46,000	317	63,000	434	—	—
X-52	52,000	358	66,000	455	—	—
X-56	56,000	386	71,000	489	—	—
X-60	60,000	413	75,000	517	—	—
X-65	65,000	448	77,000	530	—	—
X-70	70,000	482	82,000	565	—	—
X-80	80,000	551	90,000	620	120,000	827

Lincoln Products for X-80 Pipe

The following is a list, by process, of Lincoln electrodes which will meet the strength requirements for X-80 pipe.

SMAW

For a conventional, vertical up basic low hydrogen root pass, we recommend Lincoln 16P. Our European subsidiaries also have Conarc® 49 C and Kryo® 1 for root pass welding. None of these meet the strength requirements for an X-80 pipe. Depending on

the procedure, undermatched root pass electrodes are used to take advantage of the (generally) higher ductility. Overmatching electrodes are then used for the fill and cap passes.

Lincoln 16P	
Yield Strength	71,200 psi (491 MPa)
Tensile Strength	90,900 psi (627 MPa)
Elongation	22%
Hardness (Rb)	88
CVN at -20°F (-29°C)	48 ft. lbs. (65 Joules)
CVN at -50°F (-45°C)	36 ft. lbs. (49 Joules)

Fill and cap passes can be welded vertical up with Lincoln 18P to meet the strength requirements. Jet-LH 8018-C3 MR generally meets the specified criteria; however, the nickel content is approximately 1%, and can exceed the limit often imposed for sour service.

Lincoln 18P	
Yield Strength	88,700 psi (611 MPa)
Tensile Strength	99,000 psi (682 MPa)
Elongation	28%
CVN at -20°F (-29°C)	83 ft. lbs. (112 Joules)
CVN at -50°F (-45°C)	57 ft. lbs. (77 Joules)

Vertical down welding of X-80 pipe can be done with Lincoln LH-D90, which meets E9018-G electrode classification. Some data taken from a vertical down weld made on flattened X-80 pipe:

Lincoln LH-D90	
Yield Strength	87,800 psi (605 MPa)
Tensile Strength	97,000 psi (669 MPa)
Elongation	26%
CVN at -50°F (-45°C)	62 ft. lbs. (84 Joules)

Lincoln LH-D100	
Yield Strength	87,000 psi (600 MPa)
Tensile Strength	98,500 psi (679 MPa)
Elongation	24%
CVN at -50°F (-45°C)	62 ft. lbs. (84 Joules)

Vertical Down Procedures for LHD type Electrodes

- To avoid starting porosity, the electrode angle should be maintained perpendicular to the pipe when striking the arc.
- The electrode should be tapped against the pipe at the back end (top) of the crater and held close to the pipe.
- As the hot start/pencil point melts away, maintain the electrode in the same location with a very short arc. When the arc is stabilized, advance the electrode.
- A short arc (1/8") should be maintained, instead of dragging the electrode. When the electrode is dragged, a convex bead will result, especially on the bottom half of the pipe. With a short arc, the bead will be flatter.

This electrode is not recommended for root pass welding. The electrode does not penetrate sufficiently to accommodate even a small degree of mismatch (high/low condition).

When a 60° included angle joint preparation is used, the normal welding sequence would include two passes with a 1/8" (3.2 mm) electrode. After that, one or two full weave layers would be made with the 5/32" (4.0 mm) electrode. A split weave procedure would normally be used after that.


Approximate currents for this electrode are 140 amps for the 1/8" (3.2 mm) electrode, 170 amps for the 5/32" (4.0 mm) electrode, and 190 amps for the 3/16" (4.8 mm) electrode. Independent of what the recommended current setting might be, the electrode works best when run at the highest current possible without overheating. When the optimum current is used, the electrode will glow orange immediately after stopping the arc, but not overheat or breakdown when a 3 inch stub remains.

A drag angle is normally used while welding vertically down. This angle can be 30° at the 3 o'clock position, although the exact electrode angle will depend on the current used and the ability of the pipe to cool the weld pool.

On the bottom of a pipe, the electrode angle should tend towards perpendicular to the pipe, and after the 5 o'clock position, a slight push angle can be used. With a push angle on the bottom, the tendency for convex bead shapes can be overcome. With a 10° push angle and a small "horseshoe" weave, it is possible to maintain a flat bead profile.

A limited amount of weaving can be used with LHD type electrodes.

As long as the preheat, interpass, and wall thickness conditions allow it, a weave of up to one electrode diameter can reasonably be used. Weaving wider than one electrode diameter can lead to slag entrapment.

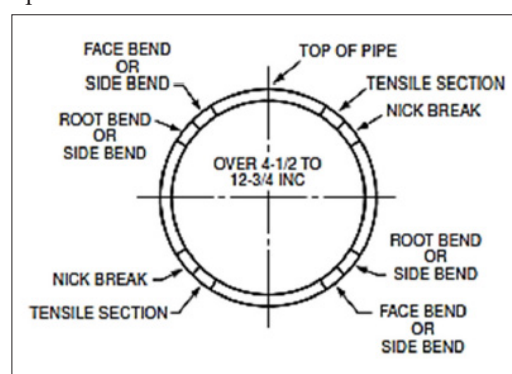

Lincoln Electric has a cellulosic electrode which meets the strength level requirements of X-80 pipe. Although cellulosic electrodes are not generally considered for this strength level, thin wall pipes have been welded successfully with these products. Root and hot passes on high strength pipe have been made with this electrode without problems. Shield-Arc 90 has an E9010-G classification, which carries with it the requirement of a 78,000 psi (538 MPa) minimum yield strength and a 90,000 psi (620 MPa) minimum tensile strength. Typical AWS test results for Shield-Arc 90 lists the following data for the 3/16" (5.0 mm) diameter.

Shield-Arc 90	
Yield Strength	84,200 psi (580 MPa)
Tensile Strength	94,400 psi (651 MPa)
Elongation	26%
CVN at -20°F (-29°C)	72 ft. lbs. (97 Joules)
CVN at -50°F (-45°C)	46 ft. lbs. (62 Joules)

FCAW (Self-Shielded)

Innershield NR-208-H was redesigned recently to meet the strength requirements of X-80 pipe. The typical results gave the following properties.

NR-208-H	
Yield Strength	81,070 psi (559 MPa)
Tensile Strength	94,100 psi (650 MPa)
Elongation	27%
CVN at -20o F(- 29o C)	53 ft. lbs. (72 Joules)
CVN at - 50o F(- 45o C)	52 ft. lbs. (70 Joules)

NR-208-H typically has a nickel content of approximately 0.85%. The yield strength of NR-208-H can reach as high as 87,000 psi (600 MPa), and the tensile strength can reach as high as 100,000 psi (684 MPa).

FCAW - Gas-Shielded

A gas-shielded, flux-cored electrode, which could conceivably be used to weld an X-80 pipe would be Outershield 91K2-H. Typical properties from an AWS plate.

Outershield 91K2-H	
Yield Strength	88,400 psi (609 MPa)
Tensile Strength	95,500 psi (658 MPa)
Elongation	27%
CVN at - 60o F (- 51o C)	60 ft. lbs. (81 Joules)

Gas mixture of 75% Argon/25% CO₂ was used.

GMAW

There are two possibilities in the Lincoln Electric product line of meeting the strength level requirements with **GMAW** electrode. **LA-100** is an ER100S-G electrode, whose typical properties on an AWS plate using 98% Argon/2% Oxygen shielding gas are as follows.

LA-90	
Yield Strength	83,000 psi (572 MPa)
Tensile Strength	95,000 psi (655 MPa)
Elongation	27%
Hardness Rb	93
CVN at - 60o F (- 51o C)	102 ft. lbs. (138 Joules)

The manganese content of the deposited metal is over 1%, and the nickel is in the range of 1.9%.

Another possibility to meet the strength requirement would be

LA-90, an ER80S-D2 and ER90S-D2 electrode. Depending on the shielding gas used, the wire diameter, and the actual procedure, this electrode would meet the strength requirement. Typical properties for this product, taken from a test plate welded with 1/16" (1.6mm) diameter electrode with 95% Argon/5% Oxygen shielding gas, are as follows:

LA-100	
Yield Strength	108,000 psi (744 MPa)
Tensile Strength	108,000 psi (744 MPa)
Elongation	21%
Hardness Rb	101
CVN at-60°F (- 51o C)	110 ft. lbs. (149 Joules)

For root pass welding, either of these electrodes could be welded with the Surface Tension Transfer™ (STT) power supply. Since this power supply is used only for the root pass, no mechanical property data is available. A CO₂ shielding gas is standard for this low spatter, low heat process.

Summary

Several alternatives are available for welding X-80 pipe, depending on the exact requirements for a project; hydrogen levels, compositional requirements (in particular, nickel), hardness, level of automation required, availability of machinery, degree of overmatch, and any number of other factors may determine the suitability of one product over another.

Pipe Welding Electrodes

Electrodes for Mild Steel Pipe

Fleetweld 5P (E6010)

Basic out-of-position electrode. Used for welding ASTM and X-42 through X-52 mild steel pipe. Your best choice for dirty, rusty, or painted pipe.

Fleetweld 5P+ (E6010)

Similar to Fleetweld 5P, with added advantages of quick striking, easy slag removal and improved final appearance. all position welding of pipe X-42 through X-52.

Shield-Arc 85 (E7010-A1)

Used for 1/2" Molybdenum pipe steels and X-42 through X-56 grade pipes. Can be handled vertical up or vertical down.

Shield-Arc HYP+ (E7010-P1)

Designed to provide improved welding characteristics for vertical down root, hot, fill or cap pass welding of API 5L pipe, grades X-52 through X-65 high strength pipe.

Shield-Arc HYP (E7010-G)

Specifically made for vertical down welding all passes on 5L or 5LX pipe, grades X-52 through X-65. Features easy operation, minimum wagon tracks and windows and almost no tendency for fill and cap pass pinholes.

Shield-Arc 70+ (E8010-G)

Very good electrode for root, hot, fill and cap passes. Primarily for vertical down, but can also be used for vertical up. Excellent wetting on the cap pass, steady concentrated arc.

Shield-Arc 80 (E8010-G)

Similar welding characteristics and bead appearance to Shield-Arc 70+ with much better low temperature impact properties. Excellent "stacking" ability, allowing slower travel speeds at high currents, thus allowing faster filling of joints.

Shield-Arc 90 (E8010-G)

Specifically designed for X-80 pipe. Similar to Shield-Arc 80 with higher strength. Can be used for root and hot passes, and for fill and cap passes up to 3/8" (9.5mm) pipe. With proper precautions, thick-er wall pipe may also be welded without cracking.

Low Hydrogen Electrodes for Pipe Welding**Lincoln 16P (E7016)**

Specially designed for vertical up welding of pipe. The thin coating of the 3/32" (2.4 mm) size allows for its use in root pass welding. Can be used in grades X-52 through X-65. Because of its unique burn-off characteristics, it is recommended for welding of open joint gaps.

Lincoln 18P (E8018G)

Low hydrogen electrode designed primarily for vertical-up fill and cap pass welding of high strength pipelines, up to and including X-80 grade.

LH-D80, LH-D90 & LH-D100 (E8018-G, E9018-G & E10018-G)

These low hydrogen electrodes are designed for vertical down on high strength pipe up to and including X-80. They have

significantly greater deposition rates than downhill cellulosic electrodes.

Jet-LH 8018-C3 MR (E8018-C3)

Produces a 1% nickel deposit for welding low temperature alloy pipe that require good notch toughness down to -60°F (51°C).

Jet-LH 8018-C1 MR (E8018-C1)

Capable of producing a 2-1/4% nickel deposit with notch toughness of 20 ft-lbs at -75°F (-59°C) for welding pipe for liquid ammonia, propane and other gases.

Jetweld LH-90 MR (E8018-B2)

Produces 1-1/4% chromium, 1/2% molybdenum deposit commonly required for high temperature, high pressure pipe.

Jetweld LH-100M1 MR (MIL-10018-M1)

Yield strength levels of 82-110,000 psi (565-758 MPa). Excellent notch toughness down to -60°F (-51°C).

Jetweld LH-110M MR (E11018-M)

Tensile strength levels of 110-128,000 psi (758-882 MPa).

Jet-LH 8018-B2 MR (E8018-B2)

Capable of producing a 1-1/4% chromium, 1% molybdenum deposit when design temperatures exceed 850°F (454°C).

Jet-LH 9018-B3 MR (E9018-B3)

Capable of producing a 2-1/4% chromium, 1% molybdenum deposit when design temperatures exceed 850°F (454°C).

Mechanical Properties

Welded and tested in accordance with appropriate AWS or MIL specifications.

Electrode	AWS Class	As-Welded				% Elong	Stress Relieved @ 1150°F / 621°C				% Elong
		Tensile Strength		Yield Strength			Tensile Strength		Yield Strength		
		Psi	MPa	Psi	MPa		Psi	MPa	Psi	MPa	
Fleetweld 5P	E6010	60-76,000	(414-524)	48-65,000	(331-448)	22-33	60-69,000	(414-476)	48-61,000	(331-421)	28-36
Fleetweld 5P+	E6010	60-86,000	(414-593)	48-76,000	(331-524)	22-33	67-78,000	(461-538)	51-67,000	(351-461)	30-34
Shield-Arc 85	E7010-A1	70-78,000	(483-538)	57-71,000	(393-489)	22-30	70-84,000	(483-579)	57-74,000	(393-512)	22-30
Shield-Arc HYP	E7010-G	70-86,000	(483-593)	60-74,000	(414-512)	22-30	80-82,000	(552-565)	72-76,000	(496-524)	24-27
Shield-Arc HYP+	E7010-P1	77-86,000	(531-593)	63-71,400	(439-482)	-	-	-	-	-	-
Shield-Arc 80	E8010-G	80-94,000	(552-648)	67-83,000	(462-572)	19-26	-	-	-	-	-
Shield-Arc 70+	E8010-G	80-97,000	(552-669)	67-82,000	(462-565)	19-31	80-88,000	(552-607)	65-78,000	(448-538)	29-31
Shield-Arc 90	E9010-G	90-100,000	(620-689)	77-88,000	(531-607)	17-26	-	-	-	-	-
Low Hydrogen Electrode											
LH-D80	E8018-G	89600	-618	76800	-530	28	-	-	-	-	-
Jet-LH 8018-C3 MR	E8018-C3	80-94,000	(551-648)	68-80,000	(469-552)	24-30	75-84,000	(517-579)	66-73,000	(455-503)	24-32
Jet-LH 8018-C1 MR	E8018-C1	80-95,000	(551-655)	67-81,000	(462-558)	19-25	80-96,000	(552-662)	66-81,000	(455-558)	19-32
LH-D80	E8018-G	89000	-618	76800	-530	28	-	-	-	-	-
LH-D90	E9018-G	99000	-682	89000	-614	29	-	-	-	-	-
LH-D100	E10018-G	106000	-731	98500	-679	-	-	-	-	-	-
Jetweld LH-90 MR	E8018-B2	97-107,000	(669-738)	84-97,000	(579-669)	17-24	90-107,000	(620-738)	77-95,000 ⁽¹⁾	(531-655)	17-24

Jetweld LH-100M1 MR	MIL-10018-M1	-	-	-	-	20-24	99-111,000 ⁽²⁾	(683-765)	88-104,000 ⁽²⁾	(607-717)	20-26 ⁽²⁾
Jet-LH 8018-B2 MR	E8018-B2	112-121,000	(772-834)	100-107,000	(689-738)	17-24	93-103,000 ⁽¹⁾	(641-710)	81-93,000 ⁽¹⁾	(558-641)	25-28
Jetweld LH-110M MR	E11018-M	110-128,000	(758-882)	98-109,000	(676-751)	20-24	110-120,000 ⁽²⁾	(758-827)	95-107,000 ⁽²⁾	(655-738)	20-26 ⁽²⁾
Jet-LH 9018-B3 MR	E9018-B3	136-147,000	-	-	-	15-22	100-114,000 ⁽¹⁾	(689-786)	86-100,000 ⁽¹⁾	(593-689)	21-25
Lincoln 16P	E7016	85-90,100	(586-621)	74900-78,000	(517-538)	28-30	-	-	-	-	-
Lincoln 18P	E8018-G	99-105	(683-727)	88700-97200	612-650	28	-	-	-	-	-

Footnotes & Notes:

⁽¹⁾ Stress relieved @ 1275°F (691°C).

⁽²⁾ Stress relieved @ 1125°F (607°C).

NOTE: Mechanical properties obtained with each type electrode also depends upon (1) chemistry of the pipe, (2) welding procedures and (3) the rate of cooling. Since these factors vary between actual... (text cuts off in original image)

In-Plant Pipe

Vertical Up Welding

Pipe End Cleaning


Pipe may be covered with a variety of coatings, which include primers, epoxy, tar, paper, varnish, rust, scale, moisture or organic contaminants. Failure to recognize and properly clean these joints can contribute to rejected welds and costly repairs. Joint cleanliness is especially important in welding pipe.

Follow these guidelines to minimize welding defects such as root pass hollow bead:

- Moisture and condensation of any type must be removed prior to welding.
- Clean both ends of the pipe on the inside and outside surfaces. The area to be cleaned should extend at least 1" (25mm) from the end of the bevel on both the inside and outside surfaces.
- A recommended method for cleaning pipe is the use of a heavy duty straight shaft grinder with a rubber expanding wheel and a carbide coated sleeve. The small shaft and reduced overall weight allow easy access to both the inside and outside pipe surfaces.

Pipe End Preparation with No Backup Ring


The dimensional requirements for welding vertically up are shown below. A 1/8" (3.2mm) gap must be maintained accurately all the way around the joint. When no backup ring is used a 1/8" Fleetweld 5P or 5P+ are recommended for the root pass.

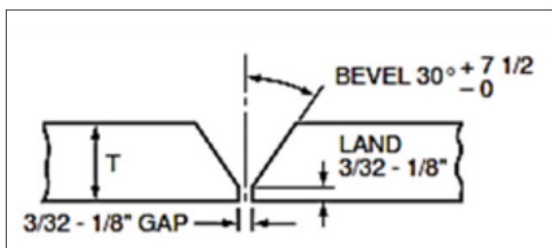

Pipe End Preparation With Backup Ring

Alloy pipe is often welded vertically up using a low hydrogen electrode. When a low hydrogen electrode is used for the first

pass a backup ring maybe used. With a backup ring, the pipe ends are made with a feather edge. The gap should be about the same as the diameter of the electrode with coating and must be consistent all the way around.

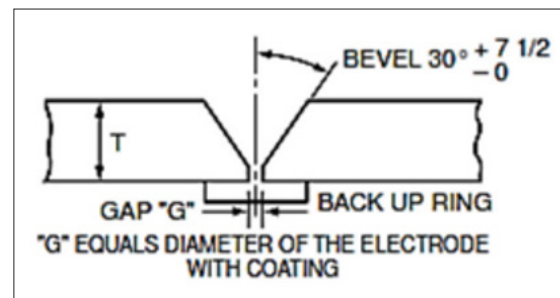

Mixed E6010, E7010, E8010, E9010 and Low Hydrogen Beads

When low hydrogen electrode is to be used, a root pass of EXX10 electrode may be necessary or advantageous. This usually arises when a special fitting with reduced gap is used or where a backup ring is undesirable.

The E6010-E9010 root pass is needed to provide adequate penetration to reach the root of the joint. By applying the E6010 - E9010 stringer bead vertically down, the first weld can be applied at higher speeds. The smaller gap also reduces the amount of electrode needed to complete the weld.


Pipe Axis - Horizontal & Vertical First Pass

The sections are lined and tacked into position with at least four tack welds. The root pass is made from bottom to top, one side at a time.

No Backup Ring

When no backup ring is used, the penetration must be complete on both lips and there must be some buildup on the inside of the joint. This inside bead should have an even surface and be at least 1/16" (1.6 mm) when starting a fresh electrode during the root pass, special care must be taken to maintain a smooth uninterrupted inside bead. With pipe axis vertical, some codes

require a full width weave for the cover pass. This weave is illustrated below:

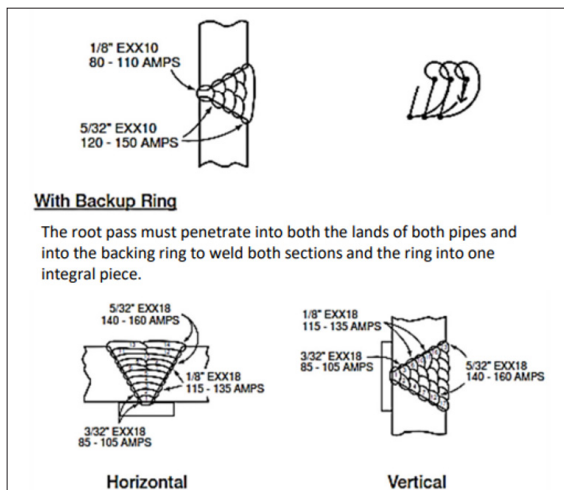

Filler Passes

Clean each bead before starting the next pass. Never start a bead at the same point as the previous bead was started. Use enough heat to assure complete fusion with the pipe wall and the adjacent bead.


The finish passes should be about walls and overlap the original gr For horizontal cap passes, particular care should be exercised to avoid undercutting on the top of the weld pass. Lower currents and a short arc should be used to minimize undercutting.

Vertical Up Procedures

Vertical Joint - (Pipe Axis Horizontal)


E6010, E7010, E8010 or E9010: DC+

Low Hydrogen Electrode: DC+

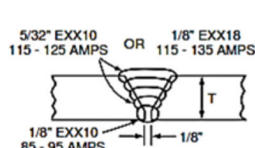

Wall Thickness		No. of Passes ⁽¹⁾
In.	(mm)	
1/4	(6.4)	2
5/16	(7.9)	2
3/8	(9.5)	3
1/2	(12.7)	3
5/8	(15.9)	4
3/4	(19.0)	6
1	(25.4)	7


5/32\" EXX18, 140 - 160 AMPS

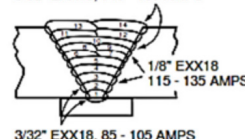

Wall Thickness		No. of Passes ⁽¹⁾
In.	(mm)	
3/8	(9.5)	3
1/2	(12.7)	4
5/8	(15.9)	5
3/4	(19.0)	7
1	(25.4)	10

Horizontal Joint - (Pipe Axis Vertical)

E6010, E7010, E8010 or E9010: DC+

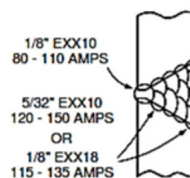

Wall Thickness		No. of Passes ⁽¹⁾
In.	(mm)	
1/4	(6.4)	2
5/16	(7.9)	3
3/8	(9.5)	4
1/2	(12.7)	—
5/8	(15.9)	—
3/4	(19.0)	—
1	(25.4)	—

⁽¹⁾ The number of passes may vary depending on operator techniques.

Wall Thickness								Wall Thickness							
3/8" (9.5 mm)				1/2" (12.7 mm)			5/8" (15.87 mm)			3/4" (19.05 mm)			1" (25.4 mm)		
Electrode Required per Joint (lbs) ⁽¹⁾								Electrode Required per Joint (lbs) ⁽¹⁾							
Pipe Diameter In. (mm)	3/32"	1/8"	Total	3/32"	1/8"	Total	3/32"	1/8"	Total	3/32"	1/8" 5/32"	Total	3/32"	1/8" 5/32"	Total
6 In. (152.4 mm)	0.51	1.34	1.85	0.51	2.31	2.82									
8 In. (203.2 mm)	0.7	1.8	2.5	0.7	3.1	3.8	0.7	4.7	5.4						
12 In. (304.8 mm)	1	2.7	3.7	1	4.7	5.7	1	7.1	8.1	1	9.9	10.9	1	16.7	17.7
16 In. (406.4 mm)	1.4	3.6	5	1.4	6.1	7.5	1.4	9.8	11.2	1.4	13.1	14.5	1.4	22.1	23.5
20 In. (508 mm)	1.7	4.5	6.2	1.7	7.7	9.4	1.7	11.7	13.4	1.7	16.4	18.1	1.7	27.6	29.3
24 In. (609.6 mm)	2	5.4	7.4	2	9.3	11.3	2	14.2	16.2	2	19.8	21.8	2	33.4	35.4
28 In. (711.2 mm)	2.4	6.2	8.6	2.4	10.8	13.2	2.4	16.5	18.9	2.4	23	25.4	2.4	38.8	41.2
32 In. (812.8 mm)	2.7	7.2	9.9	2.7	12.4	15.1	2.7	19	21.7	2.7	26.5	29.2	2.7	44.5	47.2
36 In. (914.4 mm)	3.1	8	11.1	3.1	13.9	17	3.1	21.6	24.7	3.1	29.6	32.7	3.1	49.9	53
40 In. (1016 mm)	3.4	8.9	12.3	3.4	15.4	18.8	3.4	23.5	26.9	3.4	32.8	36.2	3.4	55.3	58.7
48 In. (1219 mm)	4.1	14.7	18.8	4.1	18.5	22.6	4.1	28.3	32.4	4.1	39.5	43.6	4.1	66.6	70.7
60 In. (1524 mm)	—	—	—	5.1	23.2	28.3	5.1	45.4	50.5	5.1	49.4	54.5	5.1	83.2	88.3

ASTM Spec	Description	Grades	Suggested Electrodes
A250	C-Mo Tubes	T1, T1a, T1b	SA-85, LH-7018-A1
A333	Low Temp. Pipe	1, 6 7	Excalibur 7018-1, LH-78, LH-7018-A1
A334	Low Temp. Pipe	1, 6 7	LH-75, LH-78, LH-7018-A1 LH-8018-C1
A335	High Temp. Pipe	P1 P2, P11, P12	LH-7018-A1 LH-90, LH-8018-B2

A350	Low Temp. Fittings, etc.	LF1, LF2	Excalibur 7018-1, LH-78, LH-8018-C3
A369	High Temp. Pipe		See A335 & A182
A381	High Pressure Pipe	Y35, Y42, Y46 Y52, Y56 Y60, Y65	(1), Excalibur 7018-1, LH-78 SA-HYP, SA-85, SA-70+, SA-80, Excalibur 7018-1, SA-HYP, SA-70+, SA-80
A405	High Temp. Pipe	P24	LH-9018-B3, LH-90
A420	Low Temp. Fittings	WPL6	
A423	Carbon/Alloy Tubes Pipe	1 (1) 2	LH-90, LH-8018-B2 LH-8018-C3
A426	High Temp. Cast Pipe		See A335
A498	Condenser Tubes		See A199, A213, A334
A500	Structural Tubing	A, B, C	(1)
A501	Structural Tubing		(1)
A524	Seamless Carbon Steel Pipe	I, II	(1)
A556	Feedwater Heater Tubes	A2	(1)
A557		B2, C2	Excalibur 7018-1, LH-78
A587			
A595	Structural	A, B	
A618	Structural Tubing	WCA WCB, WCC	(1), Excalibur 7018-1, LH-78
A660	Cast High Temp. Pipe		(1), Excalibur 7018-1, LH-78 Excalibur 7018-1, LH-78
A692	Seamless Low-Alloy Tubes		SA-85, LH-7018-A1
A694	Carbon & Alloy Steel Forgings	All	Excalibur 7018-1, LH-78, LH-8018-C3
A696	Carbon Steel Bars		Excalibur 7018-1, LH-78
A699	Low Carbon Alloy Steel Plate, Shapes & Bars		LH-90, LH-110M MR
A707	Carbon & Alloy Steel Flanges	L1, L2, L3 L4, L5, L6	Excalibur 7018-1, LH-78, LH-8018-C3 LH-8018-C1
A714	Low Alloy Pipe	I, II, III IV V VI	Excalibur 7018-1, LH-78 LH-8018-C3 LH-8018-C1 LH-8018-C3
A727	Notch Tough Carbon Steel Forgings		Excalibur 7018-1, LH-78

ASTM Spec	Description	Grades	Suggested Electrodes
A105 A161	High Temp. Fittings Carbon Steel Still Tubes C-Mo Steel Still Tubes	I, II Low Carbon T1	LH-78 (1), Excalibur 7018-1, LH-78, SA-85, Excalibur 7018-1, LH-78
A178 A181	Boiler Tubes	A C	(1), Excalibur 7018-1, LH-78 Excalibur 7018-1, LH-78
A182 A199	High Temp. Fittings, etc. Heat Exchanger Tubes	F1 F2, F11, F12 T11	SA-85, LH-7018-A1, LH-8018-B2 LH-90, LH-8018-B2 LH-8018-B2
A200 A209	Refinery Still Tubes C-Mo Boiler Tubes	T11 T1, T1a, T1b	LH-8018-B2 SA-85, Excalibur 7018-1, LH-78
A210 A213	Carbon Steel Boiler Tubes Boiler Tubes	A1 C T2	(1), 60XX, 70XX SA-85, Excalibur 7018-1, LH-78 LH-90, LH-8018-B2

A216 A217	High Temp. Cast Fittings High Temp. Cast Fittings	WC1 WC4, WC6	Excalibur 7018-1 SA-85, LH-7018-A1 LH-90, LH-8018-B2
A234	Wrought Welding Fixtures	WPB, WPC WP1 WP11, WP12	(1), LH-78 LH-7018-A1, SA-85, LH-90, LH-8018-B2